SDMS DocID



June 8, 2007

Via U.S. Mail

Joseph LeMay, Remedial Project Manager US EPA - Region I 1 Congress Street Suite 1100 (HBO) Boston, MA 02114-2023

Re: Operations & Maintenance Summary Monthly Report – May 2007

UniFirst Corporation, Wells G&H Site, Woburn, MA

Dear Mr. LeMay:

On behalf of UniFirst Corporation, I am submitting the report "Source Area & Operable Unit 1, Operations & Maintenance Summary Monthly Report" for the period May 1 through May 31, 2007.

Should you have any questions, please call.

Sincerely,

Timothy M. Cosgrave

Project Manager

TMC:hs enclosure

cc: Jennifer McWeeney, BWSC, DEP

David Sullivan, TRC

Stephen Aquilino, UniFirst

Greg Bibler, Goodwin Procter LLP

Peter Cox, RETEC

Susan Brand, Cummings Properties

Valerie Lane, GeoTrans

Maryellen Johns, Remedium

Jeffrey Lawson, PCC

Jay Stewart, Lowenstein Sandler Jeff Hamel, Woodward & Curran

DONAN: 8.5 OTHER: 445683

Sprerfund Powerly Conter

N :: Wells GZH

978-772-1105

249 Ayer Road, Suite 206 Harvard, Massachusetts 01451-1133

Fax 978-428-6177 tcosgrave@harvardprojects.com

# Source Area & Operable Unit 1 Operations & Maintenance Summary Monthly Report UniFirst Corporation

May 1 - May 31, 2007

Wells G & H Site Woburn, Massachusetts

Prepared for: UniFirst Corporation 68 Jonspin Road Wilmington, Massachusetts 01887-1086

Prepared by:

Harvard Project Services L

249 Ayer Road, Suite 206 Harvard, MA 01451-1133

#### 1 Introduction

Harvard Project Services (HPS), as Operation and Maintenance Contractor of the groundwater recovery and treatment system (System) at UniFirst Corporation, 15 Olympia Avenue, Woburn, Massachusetts, has prepared this report. The System, which started pumping on September 30, 1992, is part of the ongoing Remedial Action of the Wells G&H Superfund Site in Woburn, Massachusetts. This report describes the groundwater recovery and treatment activities for the period May 1 through May 31, 2007 and identifies future RD/RA activities at the site.

## 2 System Operation & Maintenance

#### 2.1 Maintenance

Activities during the reporting period at the Treatment Plant are summarized in the Maintenance Summary Table.

Date	Activity	Company		
May 2	Routine Site Visit	HPS		
-	Monthly Sampling			
May 7	Routine Site Visit	HPS		
May 17	Routine Site Visit	HPS		
May 21	Routine Site Visit	HPS		
May 29	Routine Site Visit	HPS		

**UniFirst Treatment Plant Maintenance Summary** 

#### 2.2 Treatment System Process Flow & Pressures

The total monthly flow through the System for the reporting period was 1.91 million gallons. The average flow during this period was approximately 42.8 gallons per minute. The average hourly flow rate in gallons per minute is depicted in Figure 1.

The average hourly carbon pressure at the influent to the primary tank during the month was 8.9 psi. The trend of the carbon system pressure is illustrated in Figure 1. The process flow through the carbon vessels was Tank 1 to Tank 2 to Tank 3.

#### 2.3 Drawdown Elevation in UC22

During the reporting period, the average hourly pumping water level elevation in well UC22 was approximately 20.2 feet. The water level elevations for the month are shown on Figure 1.


# 3 Treatment System Performance

The effectiveness of the treatment system is monitored by monthly sampling and analysis. Analytical samples for routine monitoring were collected on May 2, 2007 from sample points S1, S5C1, S5C2 and S6. Monthly analytical results are summarized in the attached table, "Water Quality Summary."

### 4 Future Activities

Operation and monitoring of the groundwater extraction and treatment system will continue. Routine monthly samples will be collected on June 5 and July 5, 2007.

Figure 1: May 2007 Operations Data

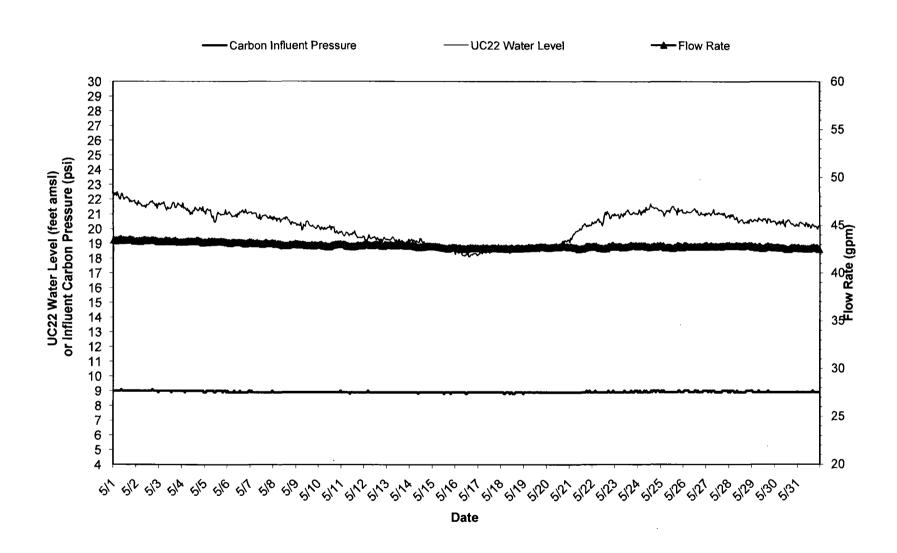

Water Quality Summary
Groundwater Treatment System
UniFirst Corporation Wells G & H Site, Woburn, Massachusetts

Sample Date:	5/2/2007				Method:	8260
Sample Location:	S1, Influent			ē		
	_			Qualifier		Detection
CAS No.	Compound		Result	<u> </u>	Units	Limit
56-23-5	Carbon Tetrachloride		<1.0		μg/L	1.0
75-34-4	1,1-Dichloroethene		<1.0		µg/L	1.0
127-18-4	Tetrachloroethene		320		μg/L	5.0
79-01-6	Trichloroethene		9		μg/L	1.0
0540-59-0	1,2-Dichloroethene (total)		1.	J	µg/L	2.0
71-55-6	1,1,1-Trichloroethane		1		μg/L	1.0
Sample Date:	5/2/2007				Method:	8260
	S5C1, 1 <sup>st</sup> carbon effluent				mouros.	0200
Cample Location.	ooo i, i ourboii ciiiuciic			<u>ij</u>		Detection
CAS No.	Compound		Result	Qualifier	Units	Limit
56-23-5	Carbon Tetrachloride		<1.0	<u> </u>	µg/L	1.0
75-34-4	1,1-Dichloroethene		<1.0		μg/L	1.0
127-18-4	Tetrachloroethene		21		μg/L	1.0
79-01-6	Trichloroethene		2		μg/L	1.0
0540-59-0	1,2-Dichloroethene (total)		3		μg/L	2.0
71-55-6	1,1,1-Trichloroethane		3		μg/L	1.0
	,,,,				F-5: -	
Sample Date:	5/2/2007				Method:	8260
Sample Location:	S5C2, 2 <sup>nd</sup> carbon effluent			6		
				Qualifier		Detection
CAS No	Compound		Result	ō	Units	Limit
56-23-5	Carbon Tetrachloride		<1.0		μg/L	1.0
75-34-4	1,1-Dichloroethene		<1.0		μg/L	1.0
127-18-4	Tetrachloroethene		<1.0		μg/L	1.0
79-01-6	Trichloroethene		<1.0		µg/L	1.0
0540-59-0	1,2-Dichloroethene (total)		<1.0		μg/L	2.0
71-55-6	1,1,1-Trichloroethane		<1.0		µg/L	1.0
0	F 10 10007					
Sample Date:	5/2/2007		,		Method:	524.2
Sample Location:	S6, final effluent	Discharge		fier		Detection
CAS No.	Compound	Discharge Limit	Result	Qualifier	Units	Detection Limit
71-43-2	Compound Benzene	5.0	<0.5	0	µg/L	0.5
56-23-5	Carbon Tetrachloride	5.0 5.0	<0.5			0.5
75-34-4	1,1-Dichloroethene	5.0 7.0	<0.5 <0.5		μg/L	
75-3 <del>4-4</del> 127-18-4	Tetrachloroethene	7.0 5.0	<0.5 <0.5		μg/L	0.5 0.5
79-01-6	Trichloroethene		<0.5 <0.5		μg/L	
79-01-6 0540-59-0		5.0 70.0	<0.5 <1.0		μg/L	0.5
71-55-6	1,2-Dichloroethene (total)		<0.5		μg/L	1.0 0.5
71-55-6 7439-92-1	1,1,1-Trichloroethane Lead, total (Method 200.7)	Monitor Only 10.2	<0.5 <0.91		μg/L μg/L	0.5
					11(3/1	11 41